

Technical Service Bulletin

69 Front seat belt twisted

69 20 47 2058455/1 February 6, 2020.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, A8, Q8, and Audi e-tron quattro	2019 - 2020	All	Not Applicable

Condition

Customer states:

- One or both front seat belts are twisted.

Workshop findings:

- The seat belt webbing was pulled through the deflector of the seat belt height adjuster while twisted. The twisting of the seat belt webbing is predominantly caused by the "seat belt park function" featured in the reversible seat belt tensioners.


Technical Background

When exiting the vehicle, the seat belt can slightly twist when unbuckled. This twist can move up to the deflector of the seat belt height adjuster when the seat belt retracts. If the "seat belt park function" then occurs, this twist can be pulled past the seat belt deflector resulting in a completely twisted seat belt.

Production Solution

The implementation of modified seat belt deflector guides for A6, A7, A8, and Audi e-tron quattro during production is in the planning stages.

The modified seat belts were implemented in Q8 production starting in December of 2019.

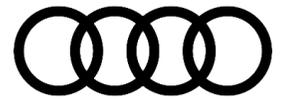

Technical Service Bulletin

Service

A6, A7, A8, and Audi e-tron quattro

1. Remove the upper B-Pillar trim on the affected side according to the repair manual.
2. Remove the bolt of the seat belt deflector (Figure 1, Pos. 3).



Tip: It is not necessary to remove the seat belt to perform this repair.

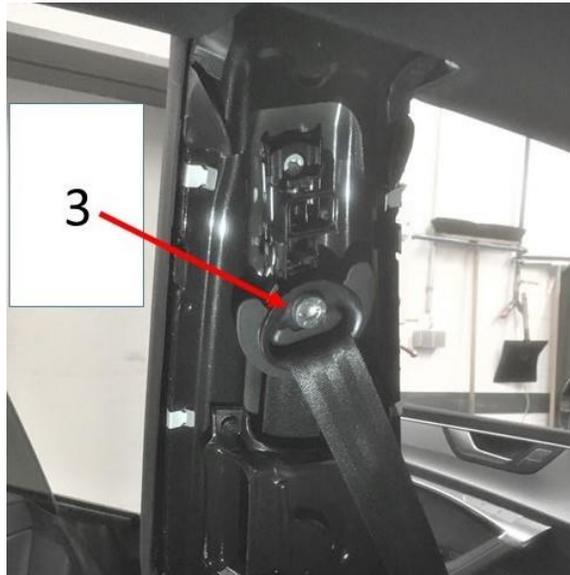


Figure 1. Seat belt deflector at height adjuster with B-Pillar trim removed.


3. Use your thumb to remove the old belt guide (plastic part) from the steel deflector. Start by detaching the guide from the bolt hole, then press out the lower section covering the metal tab (Figure 3).



Note:

Do not use sharp objects to remove the old belt guide to avoid damaging the seat belt webbing.



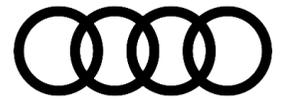

Technical Service Bulletin

Figure 2. Backside of seat belt deflector. Deflector trim tabs engaged in old belt guide.




Figure 3. Removing old seat belt guide starting at the bolt hole.

4. With the old belt guide removed, turn the seat belt webbing to remove the twist (Figure 4).



Figure 4. Old seat belt guide removed. Seat belt twist corrected.

5. Install the modified belt guide 4K8 857 799 on the front driver side and 4K8 857 800 on the front passenger side (Figure 2, Pos. 4).

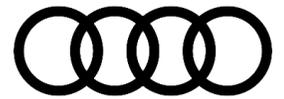

Technical Service Bulletin

6. Start installing the modified seat belt guide at the deflector metal tab (Figure 5).

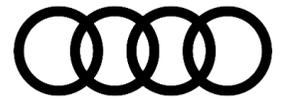


Figure 5. Installing modified seat belt guide starting with the metal tab on the bottom.

7. Push the new guide into the bolt hole until you can hear the plastic retainers snap into place (Figure 6).



Figure 6. Seat belt deflector with new guide installed.



Technical Service Bulletin

8. Inspect the front of the deflector for proper installation of the guide locking tabs at the bolt hole (Figure 7, Pos. 6)




Figure 7. Belt guide locking tabs correctly secured at bolt hole.

9. Inspect the back of the deflector for proper installation of the deflector trim locking tabs to seat belt guide (Figure 8, Pos. 7)



Figure 8. Seat belt deflector trim locking tabs properly secured to seat belt guide.

10. Reinstall the seat belt deflector at the height adjuster according to the repair manual.
11. Completely pull out the seat belt to ensure that the belt retracts as designed.
12. Reinstall the B-Pillar trim according to the repair manual.

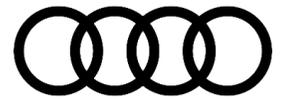

Technical Service Bulletin



Tip: Only perform this repair on the affected side.

Q8


1. Replace the affected front seat belt according to the repair manual.
2. Order the modified seat belt according to the parts table (refer to ETKA for color code).



Tip: Only perform this repair on the affected side. Only order modified seat belts for twist concerns. For all other concerns, the non-modified seat belts can be used.

Warranty

Claim Type:	Use applicable claim type. If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	6913		
Damage Code:	0010		
Labor Operations:	A6 and A7		
	Modify 1 front belt	6911 4999	40 TU
	Modify 2 front belts	6911 5099	70 TU
	A8		
	Modify 1 front belt	6911 4999	50 TU
	Modify 2 front belts	6911 5099	90 TU
	Audi e-tron quattro		
	Modify 1 front belt	6911 4999	50 TU
	Modify 2 front belts	6911 5099	80 TU
	Q8		
	Remove and install 1 belt	6911 1900	See SRT
	Remove and install 2 belts	6911 2000	See SRT

 


Technical Service Bulletin

Diagnostic Time:	GFF	0150 0000 (Q8 Only)	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2058455/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

The part numbers mentioned in this TSB are different than the ones listed in ETKA. Only use parts listed in this TSB, this includes superseding part numbers!			
Part Number		Part Description	Quantity
See ETKA		Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
4K8857799		Relay fitting, left front (A6, A7, A8, and Audi e-tron quattro)	01 as needed
4K8857800		Relay fitting, right front (A6, A7, A8, and Audi e-tron quattro)	01 as needed
Old	New	Q8 three-point automatic seat belt	
4M8857705*	4M8857705C*	Three-point automatic seat belt with belt tensioner	01 as needed
4M8857706*	4M8857706C*	Three-point automatic seat belt with belt tensioner	01 as needed
4M8857705A*	4M8857705D*	Three-point automatic seat belt with belt tensioner	01 as needed
4M8857706A*	4M8857706D*	Three-point automatic seat belt with belt tensioner	01 as needed
4M8857705B*	4M8857705E*	Three-point automatic seat belt with belt tensioner	01 as needed
4M8857706B*	4M8857706E*	Three-point automatic seat belt with belt tensioner	01 as needed
4ML857705*	4ML857705A*	Three-point automatic seat belt with belt tensioner	01 as needed

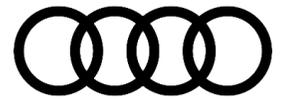

Technical Service Bulletin

4ML857706*	4ML857706A*	Three-point automatic seat belt with belt tensioner	01 as needed
------------	-------------	---	--------------

Additional Information

All parts and service references provided in this TSB (2058455) are subject to change and/or removal.

©2020 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.